

Home Report

shepherd.co.uk



All Angles Covered

Residential | Commercial | Property & Construction





Contents

- 1. Scottish Single Survey
- 2. Energy Performance Certificate
- 3. Property Questionnaire



Scottish
Single Survey



survey report on:

Property address	4/7 Fowler Terrace Edinburgh EH11 1BZ
Customer	Judith Lewis
Customer address	4/7 Fowler Terrace Edinburgh EH11 1BZ
Prepared by	Shepherd Chartered Surveyors
Date of inspection	22/05/2025



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller:
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The property comprises a purpose built second floor flat within a four storey tenement block.	
Accommodation	Second Floor - Entrance Hallway, Kitchen/Living Room, Bedroom and Shower Room with WC	
Gross internal floor area (m²)	41m2 or thereby.	
Neighbourhood and location	The subjects are situated in an established area where neighbouring properties are of a similar age and type. Adequate amenities can be found nearby.	
Age	1890 or thereby.	
Weather	Dry and clear.	
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.	
	Masonry with clay pots.	

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is pitched and laid in slate incorporating flat roof sections. No access was afforded into any roof void area.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. Cast iron gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls are of stone construction pointed externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows throughout are of a replacement UPVC double glazed type. There is a front access door.
External decorations	Visually inspected. Painted finishes noted.
Conservatories / porches	Visually inspected. Not applicable.

Communal areas	Circulation areas visually inspected.
	Communal stair accessed via an entryphone system.
Garages and permanent outbuildings	Visually inspected.
	Not applicable.
Outside areas and boundaries	Visually inspected.
	None.
Ceilings	Visually inspected from floor level.
	Presumed plastered ceilings.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for
	dampness where considered appropriate.
	Internal walls have plaster finishes.
Floors including sub floors	Flooring throughout appears to be of timber construction with fitted floor coverings. No sub-floor areas were inspected.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Internal joinery - timber.
	Internal doors - timber panel type.
	Kitchen storage is provided by a range of fitted units incorporating worktop surface areas.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	Fireplaces appeared to be blocked over.
Internal decorations	Visually inspected.
	Painted, papered and tiled finishes noted.

Cellars	Visually inspected where there was a safe and purpose- built access.
	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply. The property does not benefit from a gas meter and checks should be undertaken as to whether or not the gas is still connected.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains supply. There is a sink unit in the kitchen.
	Sanitary arrangements - three piece suite in the shower room.
Heating and hot water	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	The property benefits from electric panel heating. Domestic hot water is provided via the hot water cylinder.

Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	Presumed to the main public sewer.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.

All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbonfuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

At the time of inspection the property was furnished and floors were covered.

No sub-floor areas were inspected.

No access was gained below or beyond sanitary arrangements.

Windows and doors were tested at random.


Cupboards had stored items present.

This report should not be construed as a detailed and intrusive structural survey.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

No access was gained to the rear of the property at the time of inspection.

Sectional Diagram showing elements of a typical house

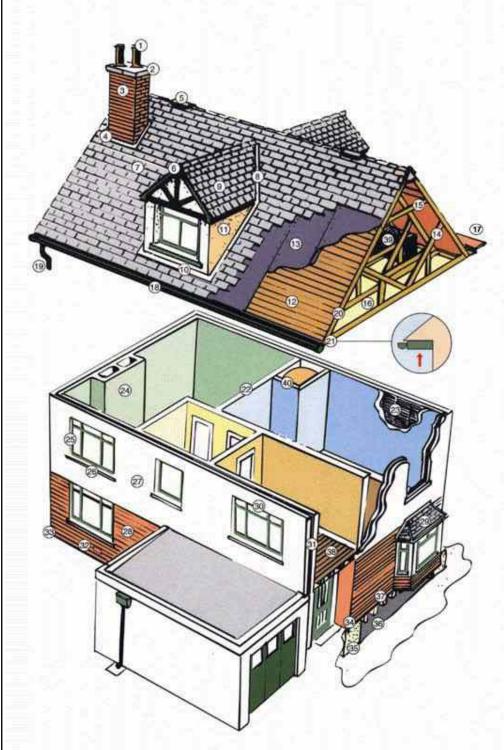

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3 Chimney head
- (4) Flashing
- 5) Ridge ventilation
- 6 Ridge board
- (7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- 14) Trusses
- 15) Collar
- 16) Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- (24) Chimney breast
- 25) Window pointing
- 26) Window sills
- 27) Rendering
- 28) Brickwork / pointing
- 29 Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- (34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 8) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	It appears the property has suffered from previous movement evident to distortions to the internal and external fabric. Within the limitations of our inspection this appears longstanding and non-progressive in nature.

Dampness, rot and infestation	
Repair category	1
Notes	Random moisture meter readings were recorded throughout the property where accessible and no significant dampness, rot or infestation was noted. A restricted damp inspection was carried out due to the presence of furniture and fittings. No comment can be made on the condition of the fabric below any floor coverings or behind any wall linings.

Chimney stacks	
Repair category	2
Notes	Weathered and damaged masonry was noted. Remedial works are required.
	Our inspection of chimneys was limited but they are of an age and style where a degree of regular ongoing maintenance should be anticipated.
	We recommend a precautionary check of the chimneys stacks and surrounding flashings is undertaken prior to purchase, especially after adverse weather conditions, by a qualified roofing contractor who can provided further advice on a necessary remedial/maintenance works required.

Roofing including roof space	
Repair category	2
Notes	Flat roof coverings have a limited life and will require regular and ongoing maintenance with a higher than average maintenance cost. Cracked slates were noted.
	We recommend a precautionary check of the roof including roof void areas is undertaken prior to purchase, especially after adverse weather conditions. Any checks should be undertaken by a qualified roofing contractor who can provided further advice on any necessary remedial/maintenance works required.

Rainwater fittings	
Repair category	2
Notes	Sections of the rainwater fittings were noted to be weathered and corroded.
	We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.

Main walls	
Repair category	2
Notes	Weathered and damaged masonry noted. Vegetation was noted to sections of the external fabric. Remedial works are required.

Windows, external doors and joinery	
Repair category	1
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted. It is assumed that replacement windows and doors comply with relevant building and fire regulations. A precautionary check of all windows and doors is recommended prior to purchase. Any checks should be undertaken by a qualified glazing contractor who can provide advice on any necessary remedial/maintenance works required.
	Sections of ironmongery are corroded and would benefit from repainting.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	N/A
Notes	Not applicable.

Communal areas	
Repair category	2
Notes	Cracked, distorted and damaged plasterwork was noted to sections of the communal stairwell. There is a slight bulge to the ground floor wall. Remedial works are required and further checks should be made in this regard prior to purchase. Communal areas leading to and surrounding the subject property have been visually inspected where possible, however it should be appreciated that there may be a common repairing liability in respect of other parts of the building out with the scope of our inspection and this should be confirmed.

Garages and permanent outbuildings	
Repair category	N/A
Notes	Not applicable.

Outside areas and boundaries	
Repair category	N/A
Notes	Not applicable.

Ceilings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces	
Repair category	1
Notes	The fireplaces/a number of the fire places have been removed/covered over. It is assumed that the chimneys are adequately vented with the chimneys capped. Ventilators should be fitted to prevent the build-up of dampness within the chimney flue.

Internal decorations	
Repair category	1
Notes	The property is in good decorative order. An asbestos survey has not been carried out to categorically confirm/deny the presence of any asbestos materials within any decorative coatings.

Cellars	
Repair category	N/A
Notes	Not applicable.

Electricity	
Repair category	1
Notes	The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.
	We recommend a precautionary check of the electrical system is advised by a qualified Electrician prior to purchase. A qualified Electrician can provide an up to date EICR Report which can provide recommendations on any necessary works required to the electrical system to ensure the system is in line with current regulations
	A precautionary check of the electrical system is recommended prior to purchase by a qualified electrician. No tests were carried out by this firm.

Gas	
Repair category	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor. All gas services have been disconnected. These should be re-instated
	under professional supervision with any associated repairs or upgrading carried out in full by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings		
Repair category	1	
Notes	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted. No inspection has been possible to enclosed timbers beneath wet appliances and no comment has been made on the condition of unseen areas. Watertight seals will require to be regularly checked and replaced, to prevent water damage to adjoining areas. Regular maintenance and upgrading of the sanitary arrangement seals is recommended to ensure complete watertightness. Properties of this age and type may contain elements of concealed lead plumbing and where this is the case we recommend any lead plumbing be	
	plumbing and where this is the case we recommend any lead plumbing be upgraded with a modern equivalent. We presume the sealants around the sanitary fittings are functional and no defects are present to the adjacent areas. A precautionary check of the areas below and adjacent to the sanitary fittings is recommended prior to purchase as these areas are prone to leakage. We have presumed that those areas not inspected are free of defects.	

Heating and hot water		
Repair category	1	
Notes	Heating is provided by electric panel/storage radiators with an immersion heater for hot water. The system was not tested. It is assumed the system has been installed, serviced and maintained to comply with all regulations. Any service/maintenance records should be sought prior to purchase. The hot water cylinder is of an older design and would benefit from being upgraded with a modern equivalent. A precautionary check is recommended prior to purchase. No tests were	
	A precautionary check is recommended prior to purchase. No tests were carried out by this firm.	

Drainage	
Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested. A precautionary check of the drainage system is recommended prior to purchase. No tests were carried out by this firm.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	N/A
Communal areas	2
Garages and permanent outbuildings	N/A
Outside areas and boundaries	N/A
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	N/A
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on? Second Floor				
2. Are there three steps or fewer to a main entrance door of the property?	Yes		No	X
3. Is there a lift to the main entrance door of the property?	Yes		No	X
4. Are all door openings greater than 750mm?	Yes		No	X
5. Is there a toilet on the same level as the living room and kitchen?	Yes	X	No	
6. Is there a toilet on the same level as a bedroom?	Yes	X	No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes	X	No	
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	X	No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It appears the property has been altered to form the current internal layout and it is presumed documentation was obtained for all works.

Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should be confirmed by inspection of the title deeds.

Where areas of maintenance, defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £210,000 (TWO HUNDRED AND TEN THOUSAND POUNDS STERLING).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £170,000 (ONE HUNDRED AND SEVENTY THOUSAND POUNDS STERLING).

Signed	Graeme Haywood Electronically signed :- 26/05/2025 16:29
Report author	Graeme Haywood
Company name	J & E Shepherd Chartered Surveyors

Address	12 Atholl Crescent Edinburgh EH3 8HA
Date of report	22/05/2025



www.shepherd.co.uk

Property Address		
Address	4/7 Fowler Terrace, Edinburgh, EH11 1BZ	
Seller's Name	Judith Lewis	
Date of Inspection	22/05/2025	
Property Details		
Property Type House	Bungalow Purpose built maisonette Converted maisonette	
Purpose built flat	Converted flat X Tenement flat Flat over non-residential use	
	Other (specify in General Remarks)	
Property Style Detached	Semi detached Mid terrace End terrace	
Back to back	High rise block X Low rise block Other (specify in General Remarks)	
Does the surveyor believe that the pmilitary, police?	property was built for the public sector, e. g. local authority, Yes X No	
Flats/Maisonettes only Floor(s) on wh	nich located Second No. of floors in block 4 Lift provided? X Yes No	
·	No. of units in block	
Approximate Year of Construction	1890	
Tenure		
X Absolute Ownership	Other	
Accommodation		
Number of Rooms 1 Living room	n(s) 1 Bedroom(s) 1 Kitchen(s)	
1 Bathroom(s	o) WC(s) Other (Specify in General remarks)	
Gross Floor Area (excluding garage	es and outbuildings) 41 m² (Internal) m² (External)	
Residential Element (greater than 4)		
Residential Element (greater than +	グ 165	
Garage / Parking / Outbuildings		
Single garage Double gar	rage Parking space X No garage / garage space / parking space	
Available on site?	No	
Permanent outbuildings:		
None.		

Construction								
Walls Roof	Brick Tile	X Stone Slate	Concrete Asphalt	Timb	er frame		er (specify in Gene er (specify in Gene	,
Special Risks								
Has the property	suffered structu	ural movement	?				X Yes	lo
If Yes, is this rece	ent or progressi	ve?					Yes X N	lo
Is there evidence the immediate vid	•	son to anticipa	ite subside	ence, heav	e, landslip	or flood in [Yes X N	lo
If Yes to any of the	ne above, provid	de details in G	eneral Re	marks.				
Service Conne	ctions							
Based on visual i the supply in Ger	•	If any services	s appear t	o be non-n	nains, pleas	se comment	on the type ar	nd locationof
Drainage	X Mains	Private		None	Water	X Mains	Private	None
Electricity Central Heating	X Mains X Yes	Private Partial		None None	Gas	X Mains	Private	None
Brief description								
Electric central heat	ing.							
Site								
Apparent legal is:	sues to be verif	ied by the con	veyancer.	Please pr	ovide a brie	ef description	n in General R	emarks.
Rights of way		ves / access G	•	•		•	service connectio	
III-defined bounda	ries Agricultura	I land included wit	h property			Other (s	specify in General	Remarks)
Location								
Residential subur		idential within tow	n / city		sidential / com		ared service conr	
Commuter village	Ren	note village		Isolated r	ural property	∐ Oti	her (specify in Ge	neral Remarks)
Planning Issue	s							
Has the property If Yes provide de			altered?	X Yes	☐ No			
Roads								
X Made up road	Unmade roa	d Partly co	ompleted nev	w road P	edestrian acc	ess only	Adopted	Unadopted

General Remarks

The roof is pitched and laid in slate incorporating flat roof sections.

At the time of inspection the property was generally consistent with age and type however items of maintenance and repair were noted.

It appears the property has suffered from previous movement evident to distortions to the internal and external fabric. Within the limitations of our inspection this appears longstanding and non-progressive in nature.

Flat roof coverings have a limited life and will require regular and ongoing maintenance with a higher than average maintenance cost.

Due to the age and style of construction ongoing maintenance and upgrading works should be anticipated to the chimneys, roof, rainwater fittings, main walls and site boundaries.

It appears the property has been altered to form the current internal layout and it is presumed documentation was obtained for all works.

Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should be confirmed by inspection of the title

Where areas of maintenance, defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

Essential Repairs			
None.			
Estimated cost of essential repairs]	
Retention recommended?	Yes X No		
Retention amount]	
Comment on Mortgageability			
The property forms suitable security for	mortgage purposes subject to the specific lend	ing criteria of any mortgage provider.	
Valuation			
Market value in present condition		£	170,000
Market value on completion of es	sential repairs	£	
Insurance reinstatement value		£	210,000
(to include the cost of total rebuilding	, site clearance, professional fees, ancilla	ry charges plus VAT)	
Is a reinspection necessary?			Yes X No

Declaration

Signed Graeme Haywood

Electronically signed :- 26/05/2025 16:29

Surveyor's name Graeme Haywood Professional qualifications MA (Hons), MRICS

Company name J & E Shepherd Chartered Surveyors
Address 12 Atholl Crescent, Edinburgh, EH3 8HA

Telephone 0131 225 1234

Email Address edinburghadminresi@shepherd.co.uk

Date of Inspection 22/05/2025



Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

Room heaters, electric

2F3, 4 FOWLER TERRACE, POLWARTH, EDINBURGH, EH11 1BZ

Dwelling type:Mid-floor flatReference number:0115-8525-8000-0552-7222Date of assessment:22 May 2025Type of assessment:RdSAP, existing dwellingDate of certificate:26 May 2025Approved Organisation:Elmhurst

Total floor area: 41 m²


Primary Energy Indicator: 305 kWh/m²/year

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,985	See your recommendations
Over 3 years you could save*	£1,680	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

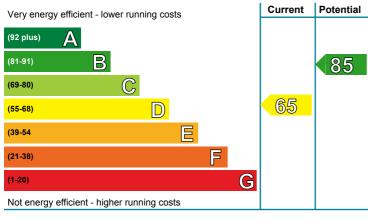


Energy Efficiency Rating

Main heating and fuel:

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (65)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

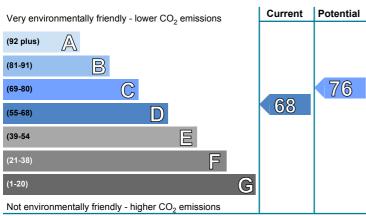

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (68)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£825.00
2 High heat retention storage heaters	£800 - £1,200	£855.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
	Solid brick, as built, no insulation (assumed)	****	***
Roof	(another dwelling above)	_	_
Floor	(another dwelling below)	_	_
Windows	Fully double glazed	****	★★★★ ☆
Main heating	Room heaters, electric	***	***
Main heating controls	Appliance thermostats	****	★★★★ ☆
Secondary heating	None	_	_
Hot water	Electric immersion, standard tariff	****	***
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 52 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,692 over 3 years	£495 over 3 years	
Hot water	£1,149 over 3 years	£648 over 3 years	You could
Lighting	£144 over 3 years	£162 over 3 years	save £1,680
Т	otals £2,985	£1,305	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Recommended measures		Indiantive and	Typical saving	Rating after improvement		
		Indicative cost per year		Energy	Environment	
1	Internal or external wall insulation	£4,000 - £14,000	£275	C 74	C 77	
2	High heat retention storage heaters and dual immersion cylinder	£800 - £1,200	£285	B 85	C 76	

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package





About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 High heat retention storage heaters

Modern storage heaters are less expensive to run than the direct acting, on-peak heating system in the property. A dual-rate electricity supply is required to provide the off-peak electricity that these heaters use; this is easily obtained by contacting the energy supplier. Ask for a quotation for high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the national wiring standards. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified electrical heating engineer. Ask the engineer to explain the options, which might also include switching to other forms of electric heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	2,334	N/A	N/A	(1,135)
Water heating (kWh per year)	1,583			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Graeme Haywood

Assessor membership number: EES/014225
Company name/trading name: J & E Shepherd
Address: L2 Atholl Crescent

Edinburgh EH3 8HA

Phone number: 0131 225 1234

Email address: edinburgh@shepherd.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire



Property address	4/7 Fowler Terrace Edinburgh EH11 1BZ
Seller(s)	Judith Lewis
Completion date of property questionnaire	20/05/2025

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership					
	How long have you owned the prope	9 years				
2.	Council tax					
	Which Council Tax band is your prop	erty in?	В			
3.	Parking					
	What are the arrangements for parking (Please tick all that apply)	ng at your property?				
	Garage	No				
	Allocated parking space	No				
	• Driveway	No				
	Shared parking	No				
	On street	Yes				
	Resident permit	Yes				
	Metered Parking	Yes				
	Other (please specify):					
4.	Conservation area					
	Is your property in a designated Con special architectural or historical into which it is desirable to preserve or e	erest, the character or appea	ea of No rance of			

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	
	<u>If you have answered yes</u> , the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	
	(iii) Please describe the changes made to the windows doors, or patio doors approximate dates when the work was completed):	(with
	Please give any guarantees which you received for this work to your solicito agent.	r or estate
7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	No
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	

If you have answered yes, please answer the three questions below:						
i) When was your central hea installed?	ting system or partial central l	neating system				
(ii) Do you have a maintenand	ce contract for the central hea	ting system?				
If you have answered yes, please give details of the company with which you have a maintenance contract:						
(iii) When was your maintenance agreement last renewed? (Please provide the month and year).						
Energy Performance Certifica	ate					
Does your property have an I than 10 years old?	Energy Performance Certificat	e which is less	Yes			
Issues that may have affected	d your property					
Has there been any storm, flood, fire or other structural damage to the property while you have owned it?						
If you have answered yes, is insurance claim?	the damage the subject of any	outstanding				
Are you aware of the existen	ce of asbestos in your propert	y?	No			
If you have answered yes, ple	ease give details:					
Services						
Please tick which services ar supplier:	e connected to your property	and give details of	the			
Services	Connected	Supplier				
Gas or liquid petroleum gas	No					
Water mains or private water supply	Yes	Scottish Water				
Electricity	Yes	Octopus				
Mains drainage	Local Authority					
Telephone	No					
Cable TV or satellite No						
	i) When was your central hear installed? (ii) Do you have a maintenance of the you have answered yes, pleyou have a maintenance constitution (Please provide the month and than 10 years old? Issues that may have affected than 10 years old? Issues that may have affected than there been any storm, fleyou have answered yes, is insurance claim? Are you aware of the existence of	i) When was your central heating system or partial central to installed? (ii) Do you have a maintenance contract for the central heat if you have answered yes, please give details of the compaty you have a maintenance contract: (iii) When was your maintenance agreement last renewed? (Please provide the month and year). Energy Performance Certificate Does your property have an Energy Performance Certificate than 10 years old? Issues that may have affected your property Has there been any storm, flood, fire or other structural darproperty while you have owned it? If you have answered yes, is the damage the subject of any insurance claim? Are you aware of the existence of asbestos in your propert If you have answered yes, please give details: Services Please tick which services are connected to your property supplier: Services Connected Gas or liquid petroleum gas No Water mains or private water supply Electricity Yes Mains drainage Yes Telephone No	i) When was your central heating system or partial central heating system installed? (ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: (iii) When was your maintenance agreement last renewed? (Please provide the month and year). Energy Performance Certificate Does your property have an Energy Performance Certificate which is less than 10 years old? Issues that may have affected your property Has there been any storm, flood, fire or other structural damage to the property while you have owned it? If you have answered yes, is the damage the subject of any outstanding insurance claim? Are you aware of the existence of asbestos in your property? If you have answered yes, please give details: Services Please tick which services are connected to your property and give details of supplier. Services Connected Supplier Gas or liquid petroleum gas No Water mains or private water supply Flectricity Yes Cotopus Mains drainage Yes Local Authority Telephone No			

	Broadband	No		
b.	Is there a septic tank system at your property?			No
	If you have answered yes, please answer the two questions below:			
	(i) Do you have appropriate consents for the discharge from your septic tank?			
	(ii) Do you have a maintenance contract for your septic tank?			
	If have answered yes, details of the company with which you have a maintenance contract:			
11.	Responsibilities for shared or common areas			
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?		Yes	
	If you have answered yes, please give details:			
	Common stair. Cleaning			
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?		Yes	
	If you have answered yes, please give details:			
	Stairwell & roof			
C.	Has there been any major rep during the time you have own	pair or replacement of any part ned the property?	of the roof	No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?		No	
	If you have answered yes, p	lease give details:		
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?		No	
	If you have answered yes, please give details:			
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)		No	
	If you have answered yes, p	lease give details:		
12.	Charges associated with the property			

a.	Is there a factor or property manager for your property?			
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:			
b.	Is there a common buildings insurance policy?	No		
	If you have answered yes, is the cost of the insurance included in monthly/annual factor's charges?			
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.			
13.	Specialist work			
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	No		
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.			
b.	As far as you are aware, has any preventative work for dry rot,wet rot, or damp ever been carried out to your property?	No		
	If you have answered yes, please give details:			
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?			
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who			
	has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.			
	Guarantees are held by:			
14.	Guarantees			
a.	Are there any guarantees or warranties for any of the following?			
	(i) Electrical work	No		
	(ii) Roofing	No		
	(iii) Central heating	No		
	(iv) National House Building Council (NHBC)	No		
	(v) Damp course	No		

	(vi) Any other work installations? (for example, cavity wall installation,	No		
	underpinning, indemnity policy)	140		
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):			
C.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:	No		
15.	Boundaries			
	So far as you are aware, has any boundary of your property been moved in thelast 10 years?	No		
	If you have answered yes, please give details:			
16.	Notices that affect your property			
	In the past three years have you ever received a notice:			
a.	advising that the owner of a neighbouring property has made a planning application?	No		
b.	that affects your property in some other way?	No		
C.	that requires you to do any maintenance, repairs or improvements to your property?	No		
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.			

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief

Name(s): judith lewis

Date: 20/05/2025

shepherd.co.uk





Home Report

Valuation Report

Executory Valuation

Tax Valuations

Separation Valuation

Private Sale Valuation

New Build & Plot Valuation

Insurance Reinstatement Valuation

Portfolio Valuation

Rental Valuation

Drive By & Desktop Valuation

Energy Performance Certificate (EPC)

Level Two Survey & Valuation Report

Level Two Condition Report

Expert Witness Report





Commercial Valuation

Commercial Agency

Acquisitions Consultancy

Commercial Lease Advisory

Rent Reviews

Asset Management

Development Appraisals & Consultancy

Auctions

Property Management

Professional Services

Licensed Trade & Leisure

Expert Witness Report

Rating

Property Investment

Public Sector



PROPERTY & CONSTRUCTION CONSULTANTS



Quantity Surveying

Building Surveying

Project Management

Dispute Resolution Support Services

Principal Designer

Clerk of Works

Commercial EPC

Health & Safety Management

Employer's Agent

Energy Consultancy

Housing Partnerships

Housing Consultancy

Development Monitoring

Mediation Services

Aberdeen

△▲△ 01224 202800

Ayr △ △ 01292 267987

Bearsden △▲ 0141 611 1500

Belfast

▲ 02890 912975

Birmingham

▲ 0121 270 2266

Coatbridge

△▲ 01236 436561

Cumbernauld △ △ 01236 780000 Dalkeith

△ △ 0131 663 2780

Dumbarton

△ ▲ 01389 731682

Dumfries

△▲△ 01387 264333

Dundee

△▲ 01382 200454

△ 01382 220699

Dunfermline

△▲ 01383 722337 △ 01383 731841

East Kilbride △▲ 01355 229317 **Edinburgh**

△ 0131 557 9300

Elain

△ ▲ 01343 553939

Falkirk

△△ 01324 635 999

Fraserburgh

△ ▲ 01346 517456

Galashiels

△△ 01896 750150

Glasgow △△△ 0141 331 2807

Glasgow South △ ▲ 0141 649 8020 **Glasgow West End** △ ▲ 0141 353 2080

Greenock

△▲01475 730717

Hamilton

△▲01698 891400

Inverness △△△01463 712239

Kilmarnock

△△01563 520318

Kirkcaldy △ △ 01592 205442

Lanark △△01555 663058 Leeds

△ 0113 322 5069

Livingston △▲ 01<u>506 41677</u>7

London

▲△ 02033 761 236

Montrose

△△ 01674 676768

Musselburgh △ △ 0131 653 3456

Oban △▲ 01631 707 800

Paisley △△ 0141 889 8334 Perth

△△ 01738 638188 △ 01738 631631

Peterhead △△ 01779 470766

St Andrews

△△ 01334 477773 △ 01334 476469

Saltcoats △ △ 01294 464228

Stirling

△△ 01786 450438 △ 01786 474476